



MICROCHIP

PIC18F2682/2685/4682/4685

PIC18F2682/2685/4682/4685 Rev. A1 Silicon Errata

The PIC18F2682/2685/4682/4685 Rev. A1 parts you have received conform functionally to the Device Data Sheet (DS39761B), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F2682/2685/4682/4685 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

All of the issues listed here will be addressed in future revisions of the PIC18F2682/2685/4682/4685 silicon.

The following silicon errata apply only to PIC18F2682/2685/4682/4685 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F2682	10 0111 000	00001
PIC18F2685	10 0111 001	00001
PIC18F4682	10 0111 010	00001
PIC18F4685	10 0111 011	00001

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFEh:3FFFFh in the device's configuration space. They are shown in hexadecimal in the format "DEVID2 DEVID1".

1. Module: ECAN™ Technology

Following an error on the bus, the ECAN module is unable to switch from Listen Only mode directly to Configuration mode.

Work around

Use the REQOP (CANCON<7:5>) bits to select Normal mode as an intermediate step, when switching from Listen Only mode to Configuration mode.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F2682/2685/4682/4685

2. Module: ECAN™ Technology

Under specific conditions, the TXBxSIDH register of the pending message for transmission may be corrupted. The following conditions must exist for this event to occur:

1. A transmit message must be pending.
2. All of the receive buffers must be full and a received message is in the Message Assembly Buffer (MAB).
3. A receiver buffer must be made available (RXBxCON<RXFUL> set to '0') when a Start-of-Frame (SOF) is recognized on the CAN bus or on the instruction cycle prior to the SOF for the TXBxSIDH corruption event to occur. The timing of this event is crucial.

Work around

Ensure that a receive buffer overflow condition does not occur, and/or ensure that a transmit request is not pending, if a received buffer overflow condition does exist.

The pseudo code segment in Example 1 on the following page is an example of how to disable a pending transmission. This code is for illustration purposes only.

Date Codes that pertain to this issue:

All engineering and production devices

EXAMPLE 1:

```
If (RXBnOVFL == 1)           // Has an overflow occurred?
{
  If (TXREQ == 1) // Is a transmission pending?
  {
    TXREQ = 0; // Clear transmit request
    If (TXABT == 1) // Store transmission aborted status value
      MyFlag = 1;
  }
}
Temp_RXREG = RXBx; // Read receive buffer
If (MyFlag)       // Was previous transmission aborted?
{
  TXREQ = 1;      // Set transmit request
  MyFlag = 0;    // Reset stored transmission aborted status
}
```

3. Module: Timer1 and Timer3

When either Timer1 or Timer3 is configured to use the external clock source in 8-Bit Asynchronous mode (T1CON<7:0> or T3CON<7:0> = 0xxx x111), writes to the corresponding TMRxH:TMRxL registers may not occur as expected.

For the purposes of this issue, instructions that directly affect the contents of the Timer registers are considered to be writes. This includes CLRF, SETF and MOVF instructions.

Work around

Insert a delay of one instruction cycle between writes to TMRxH and TMRxL. This delay can be a NOP, or any instruction that does not access the Timer registers (Example 2).

EXAMPLE 2:

```
CLRF    TMR1H
MOVLW   T1Offset ; 1 Tcy delay
MOVWF   TMR1L
```

Date Codes that pertain to this issue:

All engineering and production devices.

4. Module: 10-Bit Analog-to-Digital Converter

When the AD clock source is selected as 2 TOSC or RC (when ADCS2:ADCS0 = 000 or x11), in extremely rare cases, the EIL (Integral Linearity Error) and EDL (Differential Linearity Error) may exceed the data sheet specification at codes 511 and 512 only.

Work around

Select the AD clock source as 4 TOSC, 8 TOSC, 16 TOSC, 32 TOSC or 64 TOSC and avoid selecting 2 TOSC or RC.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F2682/2685/4682/4685

REVISION HISTORY

Rev A Document (8/2006)

First revision of this document which includes silicon issues 1-2 (ECAN).

Rev B Document (12/2006)

Updated silicon issues 1-2 (ECAN™ Technology).

Rev C Document (2/2007)

Corrected code comment in Example 1 for silicon issue 2 (ECAN™ Technology).

Rev D Document (4/2007)

Added silicon issue 3 (Timer1 and Timer3).

Rev E Document (5/2007)

Added silicon issue 4 (10-Bit Analog-to-Digital Converter).

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, rPIC and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


AmpLab, FilterLab, Linear Active Thermistor, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzylAB, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rLAB, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2007, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==**

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo
Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara
Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto
Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Fuzhou
Tel: 86-591-8750-3506
Fax: 86-591-8750-3521

China - Hong Kong SAR
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Shunde
Tel: 86-757-2839-5507
Fax: 86-757-2839-5571

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7250
Fax: 86-29-8833-7256

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-4182-8400
Fax: 91-80-4182-8422

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama
Tel: 81-45-471- 6166
Fax: 81-45-471-6122

Korea - Gumi
Tel: 82-54-473-4301
Fax: 82-54-473-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Penang
Tel: 60-4-646-8870
Fax: 60-4-646-5086

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung
Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820

12/08/06